

# ROHM Electronic Component

Ambient Light Sensor IC Series Digital 16bit Serial Output Type

## Ambient Light Sensor IC

#### BH1750FVI

No.10046ECT01

#### Descriptions

BH1750FVI is an digital Ambient Light Sensor IC for  $I^2C$  bus interface. This IC is the most suitable to obtain the ambient light data for adjusting LCD and Keypad backlight power of Mobile phone. It is possible to detect wide range at High resolution. (1 - 65535 lx).

#### Features

- 1) I<sup>2</sup>C bus Interface (f / s Mode Support )
- 2) Spectral responsibility is approximately human eye response
- 3) Illuminance to Digital Converter
- 4) Wide range and High resolution. (1 65535 lx)
- 5) Low Current by power down function
- 6) 50Hz / 60Hz Light noise reject-function
- 7) 1.8V Logic input interface
- 8) No need any external parts
- 9) Light source dependency is little. ( ex. Incandescent Lamp. Fluorescent Lamp. Halogen Lamp. White LED. Sun Light )
- 10) It is possible to select 2 type of  $I^2C$  slave-address.
- Adjustable measurement result for influence of optical window ( It is possible to detect min. 0.11 lx, max. 100000 lx by using this function. )
- 12) Small measurement variation (+/- 20%)
- 13) The influence of infrared is very small.

#### Applications

Mobile phone, LCD TV, NOTE PC, Portable game machine, Digital camera, Digital video camera, Car navigation, PDA, LCD display

#### Absolute Maximum Ratings

Parameter	Symbol	Limits	Units
Supply Voltage	Vmax	4.5	V
Operating Temperature	Topr	-40~85	°C
Storage Temperature	Tstg	-40~100	°C
SDA Sink Current	Imax	7	mA
Power Dissipation	Pd	260 <sup>*</sup>	mW

% 70mm × 70mm × 1.6mm glass epoxy board. Derating in done at 3.47mW/°C for operating above Ta=25°C.

#### •Operating Conditions

Parameter	Symbol	Min.	Тур.	Max.	Units
Vcc Voltage	Vcc	2.4	3.0	3.6	V
I <sup>2</sup> C Reference Voltage	Vdvi	1.65	-	Vcc	V

#### ●Electrical Characteristics ( Vcc = 3.0V, DVI = 3.0V, Ta = 25°C, unless otherwise noted )


Electrical Characteristics ( VCC = 3.0V, L	0VI = 3.0V,	Ta = 25°C, un	less otherwis	se noted )		
Parameter	Symbol	Min.	Тур.	Max.	Units	Conditions
Supply Current	lcc1	_	120	190	μA	Ev = 100 lx <sup>**1</sup>
Powerdown Current	lcc2	_	0.01	1.0	μA	No input Light
Peak Wave Length	λр	_	560	_	nm	
Measurement Accuracy	S/A	0.96	1.2	1.44	times	Sensor out / Actual Ix EV = 1000 Ix $^{\times 1}$ , $^{\times 2}$
Dark ( 0 lx ) Sensor out	S0	0	0	3	count	H-Resolution Mode **3
H-Resolution Mode Resolution	rhr	_	1	_	lx	
L-Resolution Mode Resolution	<b>r</b> LR	_	4	_	lx	
H-Resolution Mode Measurement Time	thr	_	120	180	ms	
L-Resolution Mode Measurement Time	tlr	_	16	24	ms	
Incandescent / Fluorescent Sensor out ratio	rlF	_	1	_	times	EV = 1000 lx
ADDR Input 'H' Voltage	Vah	0.7 * VCC	_	_	V	
ADDR Input 'L' Voltage	Val	_	_	0.3 * VCC	V	
DVI Input 'L' Voltage	Vdvl	_	_	0.4	V	
SCL, SDA Input 'H' Voltage 1	VIH1	0.7 * DVI	_	_	V	DVI ≧ 1.8V
SCL, SDA Input 'H' Voltage 2	VIH2	1.26	_	_	V	1.65V ≦ DVI <1.8V
SCL, SDA Input 'L' Voltage 1	Vi∟1	_	_	0.3 * DVI	V	DVI ≧ 1.8V
SCL, SDA Input 'L' Voltage 2	VIL2	_	—	DVI – 1.26	V	$1.65V \leq DVI < 1.8V$
SCL, SDA, ADDR Input 'H' Current	Ін	_	_	10	μA	
SCL, SDA, ADDR Input 'L' Current	١L	_	—	10	μA	
I <sup>2</sup> C SCL Clock Frequency	fscl	_	_	400	kHz	
I <sup>2</sup> C Bus Free Time	<b>t</b> BUF	1.3	_	_	μs	
I <sup>2</sup> C Hold Time ( repeated ) START Condition	thdsta	0.6	_	_	μs	
I <sup>2</sup> C Set up time for a Repeated START Condition	<b>t</b> SUSTA	0.6	_	_	μs	
I <sup>2</sup> C Set up time for a Repeated STOP Condition	tsustd	0.6	_	_	μs	
I <sup>2</sup> C Data Hold Time	<b>t</b> HDDAT	0	_	0.9	μs	
I <sup>2</sup> C Data Setup Time	<b>t</b> SUDAT	100	—	_	ns	
I <sup>2</sup> C 'L' Period of the SCL Clock	tLOW	1.3	_	_	μs	
I <sup>2</sup> C 'H' Period of the SCL Clock	tніgн	0.6	—	_	μs	
I <sup>2</sup> C SDA Output 'L' Voltage	Vol	0	_	0.4	V	IOL = 3 mA
X1 White LED is used as optical source		0	ι	0		


※1 White LED is used as optical source.


\*2 Measurement Accuracy typical value is possible to change '1' by "Measurement result adjustment function".

%3 Use H-resolution mode or H-resolution mode2 if dark data ( less than 10 lx ) is need.

#### Reference Data

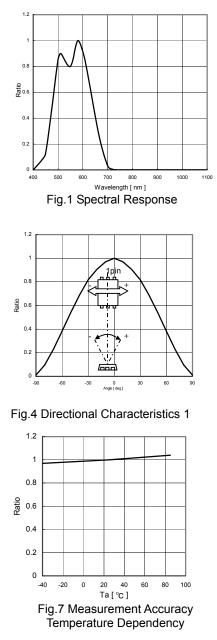

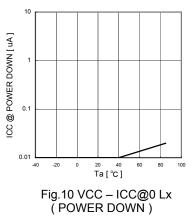

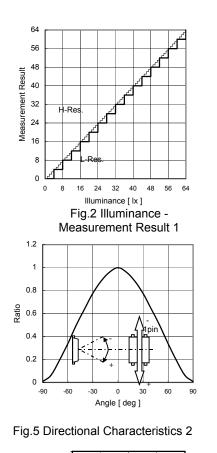

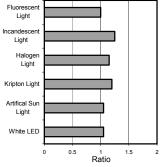
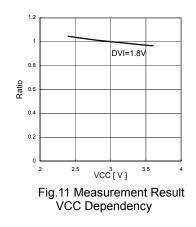


Fig.8 Light Source Dependency (Fluorescent Light is set to '1')




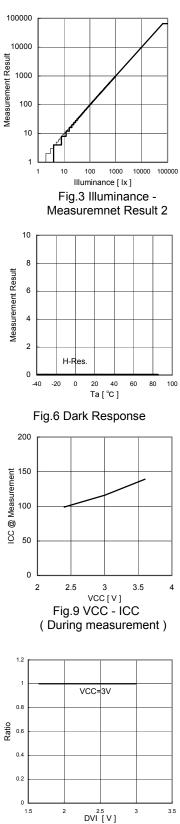


Fig.12 Measurement Result DVI Dependency

#### Block Diagram

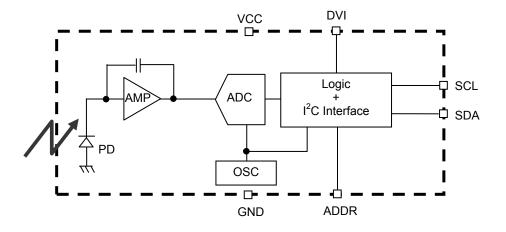

#### Block Diagram Descriptions

#### ۰PD

Photo diode with approximately human eye response.

• AMP

Integration-OPAMP for converting from PD current to Voltage.

• ADC

AD converter for obtainment Digital 16bit data.

Logic + I<sup>2</sup>C Interface

Ambient Light Calculation and I<sup>2</sup>C BUS Interface. It is including below register.


Data Register  $\rightarrow$  This is for registration of Ambient Light Data. Initial Value is "0000\_0000\_0000\_0000".

Measurement Time Register  $\rightarrow$  This is for registration of measurement time. Initial Value is "0100\_0101".

• OSC

Internal Oscillator ( typ. 320kHz ). It is CLK for internal logic.

#### Measurement Procedure

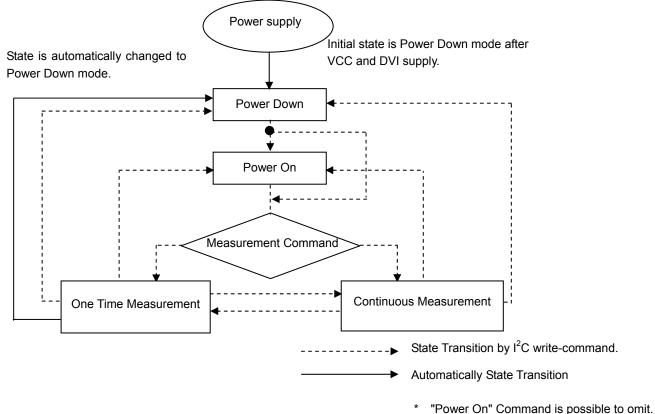

#### Instruction Set Architecture

Instruction	Opecode	Comments
Power Down	0000_0000	No active state.
Power On	0000_0001	Waiting for measurement command.
Reset	0000_0111	Reset Data register value. Reset command is not acceptable in Power Down mode.
Continuously H-Resolution Mode	0001_0000	Start measurement at 1lx resolution. Measurement Time is typically 120ms.
Continuously H-Resolution Mode2	0001_0001	Start measurement at 0.5lx resolution. Measurement Time is typically 120ms.
Continuously L-Resolution Mode	0001_0011	Start measurement at 4Ix resolution. Measurement Time is typically 16ms.
One Time H-Resolution Mode	0010_0000	Start measurement at 1lx resolution. Measurement Time is typically 120ms. It is automatically set to Power Down mode after measurement.
One Time H-Resolution Mode2	0010_0001	Start measurement at 0.5lx resolution. Measurement Time is typically 120ms. It is automatically set to Power Down mode after measurement.
One Time L-Resolution Mode	0010_0011	Start measurement at 4lx resolution. Measurement Time is typically 16ms. It is automatically set to Power Down mode after measurement.
Change Measurement time ( High bit )	01000_MT[7,6,5]	Change measurement time. ※ Please refer "adjust measurement result for influence of optical window."
Change Masurement time ( Low bit )	011_MT[4,3,2,1,0]	Change measurement time. ※ Please refer "adjust measurement result for influence of optical window."

※ Don't input the other opecode.

#### Measurement mode explanation

Measurement Mode	Measurement Time.	Resolurtion
H-resolution Mode2	Typ. 120ms.	0.5 lx
H-Resolution Mode	Typ. 120ms.	1 lx.
L-Resolution Mode	Typ. 16ms.	4 lx.

We recommend to use H-Resolution Mode.

Measurement time (integration time) of H-Resolution Mode is so long that some kind of noise(including in 50Hz / 60Hz noise) is rejected. And H-Resolution Mode is 1 I x resolution so that it is suitable for darkness (less than 10 lx) H-resolution mode2 is also suitable to detect for darkness.

Explanation of Asynchronous reset and Reset command "0000\_0111"

1) Asynchronous reset

All registers are reset. It is necessary on power supply sequence. Please refer "Timing chart for VCC and DVI power supply sequence" in this page. It is power down mode during DVI = 'L'.


2) Reset command

Reset command is for only reset Illuminance data register. (reset value is '0') It is not necessary even power supply sequence. It is used for removing previous measurement result. This command is not working in power down mode, so that please set the power on mode before input this command.

•Timing chart for VCC and DVI power supply sequence

DVI is I<sup>2</sup>C bus reference voltage terminal. And it is also asynchronous reset terminal. It is necessary to set to 'L' after Vcc is supplied. In DVI 'L' term, internal state is set to Power Down mode.

1) Recommended Timing chart1 for VCC and DVI supply.

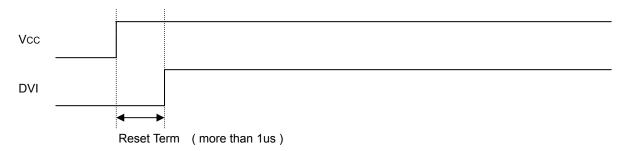

2) Timing chart2 for VCC and DVI supply. (If DVI rises within 1µs after VCC supply)

Vcc DVI Reset Term (more than 1us) Don't care state ADDR, SDA, SCL is not stable if DVI 'L' term (1us) is not given by systems. In this case, please connect the resisters ( approximately 100kOhm ) to ADDR without directly connecting to VCC or GND, because it is 3 state buffer for Internal testing.

#### Measurement sequence example from "Write instruction" to "Read measurement result"

```
ex1) Continuously H-resolution mode ( ADDR = 'L' )
```



from Master to Slave


from Slave to Master

① Send "Continuously H-resolution mode " instruction

ST	0100011	0	Ack	00010000	Ack	SP
----	---------	---	-----	----------	-----	----

2 Wait to complete 1st H-resolution mode measurement.( max. 180ms. )

③ Read measurement result.



How to calculate when the data High Byte is "10000011" and Low Byte is "10010000"  $(2^{15} + 2^9 + 2^8 + 2^7 + 2^4) / 1.2 \approx 28067$  [ lx ]


The result of continuously measurement mode is updated.( 120ms.typ at H-resolution mode, 16ms.typ at L-resolution mode )

- ex2) One time L-resolution mode ( ADDR = 'H' )
  - ① Send "One time L-resolution mode " instruction

ST	1011100	0	Ack	00100011	Ack	SP
----	---------	---	-----	----------	-----	----

2 Wait to complete L-resolution mode measurement.( max. 24ms. )

③ Read measurement result



How to calculate when the data High Byte is "00000001" and Low Byte is "00010000"

 $(2^8 + 2^4) / 1.2 \approx 227 [lx]$ 

In one time measurement, Statement moves to power down mode after measurement completion. If updated result is need then please resend measurement instruction.


#### •Application circuit example of DVI terminal

The DVI terminal is an asynchronous reset terminal. Please note that there is a possibility that IC doesn't operate normally if the reset section is not installed after the start-up of Vcc.

(Please refer to the paragraph of "Timing chart for Vcc and DVI power supply sequence" )


The description concerning SDA and the terminal SCL is omitted in this application circuit example. Please design the application the standard of the I2C bus as it finishes being satisfactory. Moreover, the description concerning the terminal ADDR is omitted. Please refer to the paragraph of "Timing chart for Vcc and DVI power supply sequence" about the terminal ADDR design.

ex 1) The control signal line such as CPU is connected.

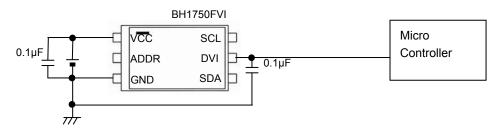


#### ex 2) Reset IC is used.


1, For Reset IC of the Push-Pull type

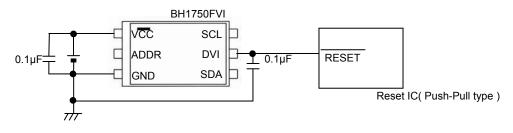

2, For Reset IC of the Open drain output

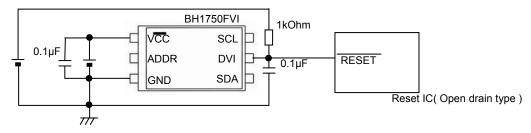


#### ex 3) A different power supply is used.

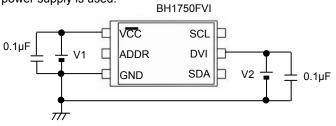

※ Power supply of DVI must stand up later than power supply of VCC stand up, because it is necessary to secure reset section (1µs or more).

ex 4) LPF using CR is inserted between VCC and DVI.


This method has the possibility that the Reset section of turning on the power supply can not satisfied. cannot be satisfied. Please design the set considering the characteristic of the power supply enough.

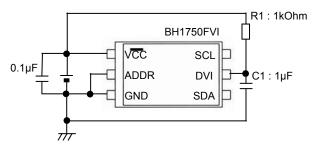

Notes when CR is inserted between VCC and DVI

 Please note that there is a possibility that reset section (1μs) can not be satisfied because the power supply is turned on when the rise time of VCC is slow
 When VCC is turned off, the DVI voltage becomes higher than VCC voltage but IC destruction is not occred if recommended constant (R1 = 1kOhm, C1 = 1μF) is used.

Please note that there is a possibility that Reset section (1µsec) cannot be satisfied if wait time is not enough long after turning off VCC. (It is necessary to consider DVI voltage level after turning off VCC.)

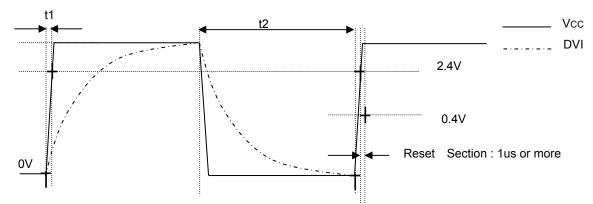


\* Please do the application design to secure Reset section 1us or more after the reclosing of the power supply.

Example of designing set when CR (C = 1μF, R = 1kΩ) is inserted between VCC and DVI with VCC=2.8V

(1) The rise time to  $0 \rightarrow 2.4V$  of VCC must use the power supply of 100 µs or less.

②Please wait 25ms or more after VCC turn off (VCC <= 0.05V), because it is necessary to secure reset section (1µs or more).

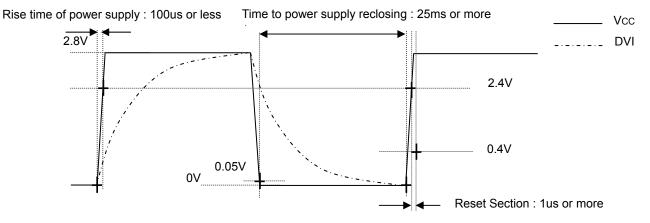


- Please do the application design to secure Reset section 1us or more after the reclosing of the power supply.

#### ●I<sup>2</sup>C Bus Access

#### 1) I<sup>2</sup>C Bus Interface Timing chart

Write measurement command and Read measurement result are done by I<sup>2</sup>C Bus interface. Please refer the formally specification of I<sup>2</sup>C Bus interface, and follow the formally timing chart.

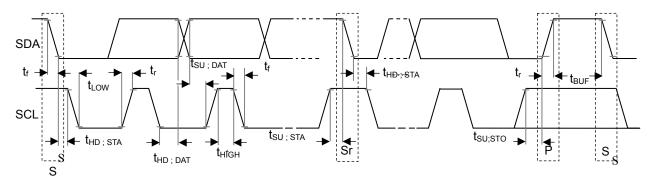

#### 2) Slave Address


Slave Address is 2 types, it is determined by ADDR Terminal ADDR = 'H' (ADDR  $\geq 0.7$ VCC)  $\rightarrow$  "1011100" ADDR = 'L' (ADDR  $\leq 0.3$ VCC)  $\rightarrow$  "0100011"

#### 3 ) Write Format

BH1750FVI is not able to accept plural command without stop condition. Please insert SP every 1 Opecode.

ST	Slave Address	R/W 0	Ack	Opecode	Ack	SP	
----	---------------	----------	-----	---------	-----	----	--

#### 4) Read Format

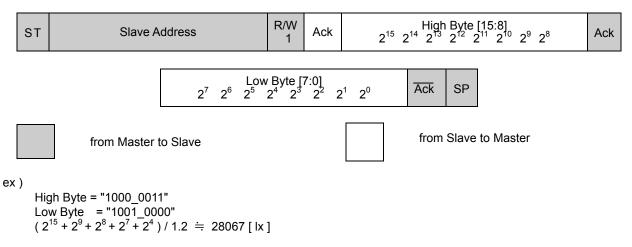

\* I<sup>2</sup>C BUS is trademark of Phillips Semiconductors. Please refer formality specification.

#### Adjust measurement result for influence of optical window. (sensor sensitivity adjusting)

BH1750FVI is possible to change sensor sensitivity. And it is possible to cancel the optical window influence (difference with / without optical window) by using this function. Adjust is done by changing measurement time. For example, when transmission rate of optical window is 50% (measurement result becomes 0.5 times if optical window is set), influence of optical window is ignored by changing sensor sensitivity from default to 2 times

Sensor sensitivity is shift by changing the value of MTreg (measurement time regisiter). MTreg value has to set 2 times if target of sensor sensitivity is 2 times. Measurement time is also set 2 times when MTreg value is changed from default to 2 times.

ex) Procedure for changing target sensor sensitivity to 2 times.

Please change Mtreg from "0100\_0101" ( default ) to "1000\_1010" ( default \* 2 ).

#### 1) Changing High bit of MTreg

ST	Slave Address	R/W 0	Ack	01000_100	Ack	SP	
----	---------------	----------	-----	-----------	-----	----	--

#### 2) Changing Low bit of MTreg

ST	Slave Address	R/W	Ack	011_01010	Ack	SP	
0.		0	7 1011		7 1011	0.	

#### 3) Input Measurement Command

	ST	Slave Address	R/W 0	Ack	0001_0000	Ack	SP	
--	----	---------------	----------	-----	-----------	-----	----	--

\* This example is High Resolution mode, but it accepts the other measurement.

4) After about 240ms, measurement result is registered to Data Register.( High Resolution mode is typically 120ms, but measurement time is set twice. )

The below table is seeing the changable range of MTreg.

		Min.	Тур.	Max.
	binony	0001_1111	0100_0101	1111_1110
changable	binary	( sensitivity : default * 0.45 )	default	(sensitivity:default * 3.68)
range of MTreg	dooimal	31	69	254
	decimal	(sensitivity:default * 0.45)	default	(sensitivity:default * 3.68)

It is possilbe to detect 0.23lx by using this function at H-resolution mode. And it is possilbe to detect 0.11lx by using this function at H-resolution mode2.

The below formula is to calculate illuminance per 1 count.

 $\begin{array}{l} \mbox{H-reslution mode : Illuminance per 1 count ( lx / count ) = 1 / 1.2 *(69 / X ) \\ \mbox{H-reslution mode2 : Illuminance per 1 count ( lx / count ) = 1 / 1.2 *(69 / X ) / 2 \end{array}$ 

1.2 : Measurement accuracy69 : Default value of MTreg ( dec )X : MTreg value

The below table is seeing the detail of resolution.

Mtreg の値	lx / count at H-resolutin mode	lx / count at H-resolution mode2			
0001_1111	1.85	0.93			
0100_0101	0.83	0.42			
1111_1110	0.23	0.11			

## BH1750FVI

#### H-Resolution Mode2

H-resolution mode2 is 0.5lx (typ.) resolution mode. It is suitable if under less than 10 lx measurement data is necessary. This measurement mode supports "Adjust measurement result for influence of optical window". Please refer it. It is possible to detect min. 0.11 lx by using H-resolution mode2.

|--|

Instruction	Opecode	Comments			
Continuously H Desclution Mode?	0001 0001	Start measurement at 0.51x resolution.			
Continuously H-Resolution Mode2	0001_0001	Start measurement at 0.5lx resolution. Measurement Time is typically 120ms. Start measurement at 0.5lx resolution. Measurement Time is typically 120ms.			
		Start measurement at 0.5lx resolution.			
One Time H-Resolution Mode2	0010_0001	Measurement Time is typically 120ms.			
		It is automatically set to Power Down mode after measurement.			

O Measurement sequence example from "Write instruction" to "Read measurement result"

#### ex) Continuously H-resolution mode2 (ADDR = 'L')



from Master to Slave

from Slave to	Master

① Send "Continuously H-resolution mode2 " instruction

ST	0100011	0	Ack	00010001	Ack	SP	
----	---------	---	-----	----------	-----	----	--

2 Wait to complete 1st H-resolution mode2 measurement.( max. 180ms. )

#### ③ Read measurement result.

ST	01	00011		1	Ack	2 <sup>14</sup> 2	High E <sup>13</sup> 2 <sup>12</sup> 2	Byte [15 2 <sup>11</sup> 2 <sup>10</sup>	5:8] 2 <sup>9</sup> 2 <sup>8</sup>	<sup>3</sup> 2 <sup>7</sup>	Ack
		2 <sup>6</sup>	Low 2 <sup>5</sup> 2 <sup>4</sup> 2	Byte [7 <sup>3</sup> 2 <sup>2</sup>	2:0] 2 <sup>1</sup> 2 <sup>0</sup>	2 <sup>-1</sup>	Ack	SP			

How to calculate when the data High Byte is "00000000" and Low Byte is "00010010"

 $(2^{3}+2^{0})/1.2 \approx 7.5$  [ lx ]


#### Terminal Description


escription Terminal Name	Equivalent Circuit	Function
VCC		Power Supply Terminal
ADDR		I <sup>2</sup> C Slave-address Terminal ADDR = 'H' (ADDR $\geq$ 0.7Vcc) "1011100" ADDR = 'L' (ADDR $\leq$ 0.3Vcc) "0100011" ADDR Terminal is designed as 3 state buffer for internal test. So that please take care of Vcc and DVI supply procedure.Please see P6.
GND		GND Terminal
SDA		I <sup>2</sup> C bus Interface SDA Terminal
DVI		SDA, SCL Reference Voltage Terminal And DVI Terminal is also asynchronous Reset for internal registers.So that please set to 'L' ( at least 1 $\mu$ s, DVI <= 0.4V ) after Vcc is supplied. BH1750FVI is pulled down by 150kOhm while DVI = 'L'.
SCL		I <sup>2</sup> C bus Interface SCL Terminal
	Terminal Name VCC ADDR GND SDA DVI	Terminal Name       Equivalent Circuit         VCC       Image: Constraint of the second

%These values are design-value, not guaranteed.

#### BH1750FVI


#### Package Outlines

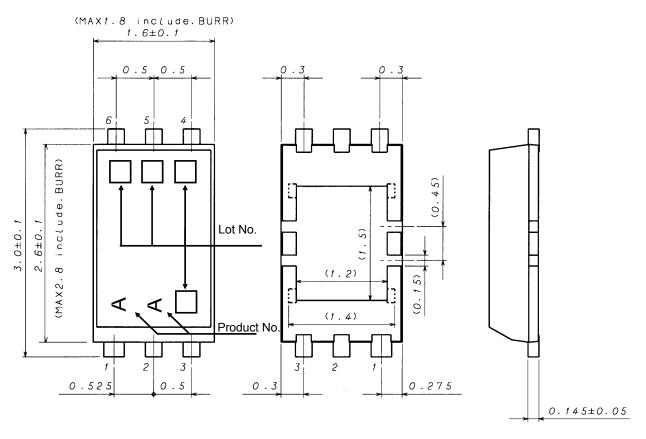

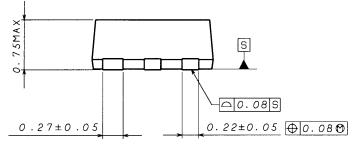

WSOF6I ( Unit : mm )


•About an optical design on the device

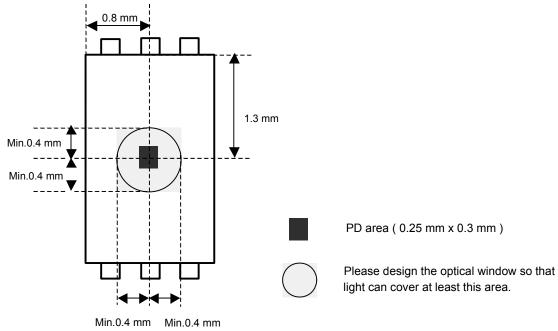


•The method of distinguishing 1pin.

- There is some method of distinguishing 1pin.

- Distinguishing by 1Pin wide-lead
   Distinguishing by die pattern
   Distinguishing by taper part of 1-3pin side
  - 2 (by die patern) is the easiest method to distinguish by naked eye.

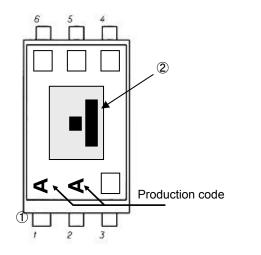



#### Cautions on use

#### 1) Absolute Maximum Ratings

An excess in the absolute maximum ratings, such as supply voltage (Vmax), temperature range of operating conditions (Topr), etc., can break down devices, thus making impossible to identify breaking mode such as a short circuit or an open circuit. If any special mode exceeding the absolute maximum ratings is assumed, consideration should be given to take physical safety measures including the use of fuses, etc.

#### 2) GND voltage

Make setting of the potential of the GND terminal so that it will be maintained at the minimum in any operating state. Furthermore, check to be sure no terminals are at a potential lower than the GND voltage including an actual electric transient.

3) Short circuit between terminals and erroneous mounting

In order to mount ICs on a set PCB, pay thorough attention to the direction and offset of the ICs. Erroneous mounting can break down the ICs. Furthermore, if a short circuit occurs due to foreign matters entering between terminals or between the terminal and the power supply or the GND terminal, the ICs can break down.

#### 4) Operation in strong electromagnetic field

Be noted that using ICs in the strong electromagnetic field can malfunction them.

5) Inspection with set PCB

On the inspection with the set PCB, if a capacitor is connected to a low-impedance IC terminal, the IC can suffer stress. Therefore, be sure to discharge from the set PCB by each process. Furthermore, in order to mount or dismount the set PCB to/from the jig for the inspection process, be sure to turn OFF the power supply and then mount the set PCB to the jig. After the completion of the inspection, be sure to turn OFF the power supply and then dismount it from the jig. In addition, for protection against static electricity, establish a ground for the assembly process and pay thorough attention to the transportation and the storage of the set PCB.

6) Input terminals

In terms of the construction of IC, parasitic elements are inevitably formed in relation to potential. The operation of the parasitic element can cause interference with circuit operation, thus resulting in a malfunction and then breakdown of the input terminal. Therefore, pay thorough attention not to handle the input terminals; such as to apply to the input terminals a voltage lower than the GND respectively, so that any parasitic element will operate. Furthermore, do not apply a voltage to the input terminals when no power supply voltage is applied to the IC. In addition, even if the power supply voltage is applied, apply to the input terminals a voltage lower than the power supply voltage or within the guaranteed value of electrical characteristics.

#### 7) Thermal design

Perform thermal design in which there are adequate margins by taking into account the power dissipation (Pd) in actual states of use.

8) Treatment of package

Dusts or scratch on the photo detector may affect the optical characteristics. Please handle it with care.

9) Rush current


When power is first supplied to the CMOS IC, it is possible that the internal logic may be unstable and rush current may flow instantaneously. Therefore, give special consideration to power coupling capacitance, power wiring, width of GND wiring, and routing of connections.

#### 10) The exposed central pad on the back side of the package


There is an exposed central pad on the back side of the package. But please do it non connection. (Don't solder, and don't do electrical connection) Please mount by Footprint dimensions described in the Jisso Information for WSOF6I. This pad is GND level, therefore there is a possibility that LSI malfunctions and heavy-current is generated.

#### BH1750FVI

#### Ordering part number



#### WSOF6I

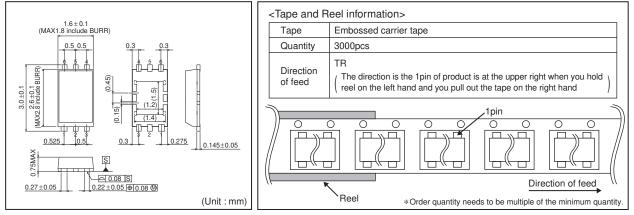

	copying or reproduction of this document, in part or in whole, is permitted without the sent of ROHM Co.,Ltd.
The	content specified herein is subject to change for improvement without notice.
"Pro	content specified herein is for the purpose of introducing ROHM's products (hereinafte oducts"). If you wish to use any such Product, please be sure to refer to the specifications ch can be obtained from ROHM upon request.
illus	mples of application circuits, circuit constants and any other information contained herein strate the standard usage and operations of the Products. The peripheral conditions mus aken into account when designing circuits for mass production.
Hov	at care was taken in ensuring the accuracy of the information specified in this document vever, should you incur any damage arising from any inaccuracy or misprint of sucl rmation, ROHM shall bear no responsibility for such damage.
exa imp othe	technical information specified herein is intended only to show the typical functions of an mples of application circuits for the Products. ROHM does not grant you, explicitly o licitly, any license to use or exercise intellectual property or other rights held by ROHM and er parties. ROHM shall bear no responsibility whatsoever for any dispute arising from the of such technical information.
equ	Products specified in this document are intended to be used with general-use electronic ipment or devices (such as audio visual equipment, office-automation equipment, commutation devices, electronic appliances and amusement devices).
The	Products specified in this document are not designed to be radiation tolerant.
	le ROHM always makes efforts to enhance the quality and reliability of its Products, a duct may fail or malfunction for a variety of reasons.
aga failu sha	ase be sure to implement in your equipment using the Products safety measures to guard inst the possibility of physical injury, fire or any other damage caused in the event of the ire of any Product, such as derating, redundancy, fire control and fail-safe designs. ROHN Il bear no responsibility whatsoever for your use of any Product outside of the prescribed pe or not in accordance with the instruction manual.
sys may inst con of t	Products are not designed or manufactured to be used with any equipment, device or tem which requires an extremely high level of reliability the failure or malfunction of which y result in a direct threat to human life or create a risk of human injury (such as a medicar rument, transportation equipment, aerospace machinery, nuclear-reactor controller, fuel- troller or other safety device). ROHM shall bear no responsibility in any way for use of any he Products for the above special purposes. If a Product is intended to be used for an h special purpose, please contact a ROHM sales representative before purchasing.
be	bu intend to export or ship overseas any Product or technology specified herein that mat controlled under the Foreign Exchange and the Foreign Trade Law, you will be required to ain a license or permit under the Law.



Thank you for your accessing to ROHM product informations. More detail product informations and catalogs are available, please contact us.

## ROHM Customer Support System

http://www.rohm.com/contact/